

Vehicle Inspection Report

Report 26/04/2019 15:06
Date:
Reg: PJ16WJO
VIN: WV1ZZZ2FZG7006567

NAMA Grading



Grade

4

Appraised By: Richard Hicks

General Details

Make: VOLKSWAGEN	Transmission: Manual	Former Keepers: 1
Model: CRAFTER CR35 TDI - 1968cc	Fuel Type: Diesel	Total Loss: No
Doors: 2	Mileage: 42,298 miles	Police Vehicle: No
Body Type: Van	Date of 1st Reg: 19/05/2016	Taxi or Private Hire: No
Colour: White	Year of MFR: 2016	Import or Re-registered: No

Tyres

Location	Tread (mm)	Brand
OSF	3	Budget
NSF	5	Budget
OSR	0	Budget
NSR	3	Budget

Spare: Steel
Jack: Yes
Wheel Brace: Yes

Wheels

Location	Alloy	Wheel Trim
OSF	N/A	
OSR	N/A	
NSF	N/A	
NSR	N/A	

Exterior

Metallic Paint: No
Body Work Condition: Average

See condition report.

Interior

Carpets	Average
Upholstery	Average
Seats	Poor
Adverse Smell	No
Comments	

Catalogue Notes

Condition Report

Component	Condition	Severity	Repair
Seat Base Cover osf	Holed	Over 3mm	Replace
Wing osf	Dented	Over 30mm	Repair and Refinish
Door osf	Dented	Over 30mm	Repair and Refinish
Wing nsf	Dented	With Paint Damage	Repair and Refinish

Damage Assessment



Seat Base Cover

Holed
Over 3mm
Replace



Wing

Dented
Over 30mm
Repair and Refinish



Door


Dented
Over 30mm
Repair and Refinish



Wing

Dented
With Paint Damage
Repair and Refinish

Vehicle Splat

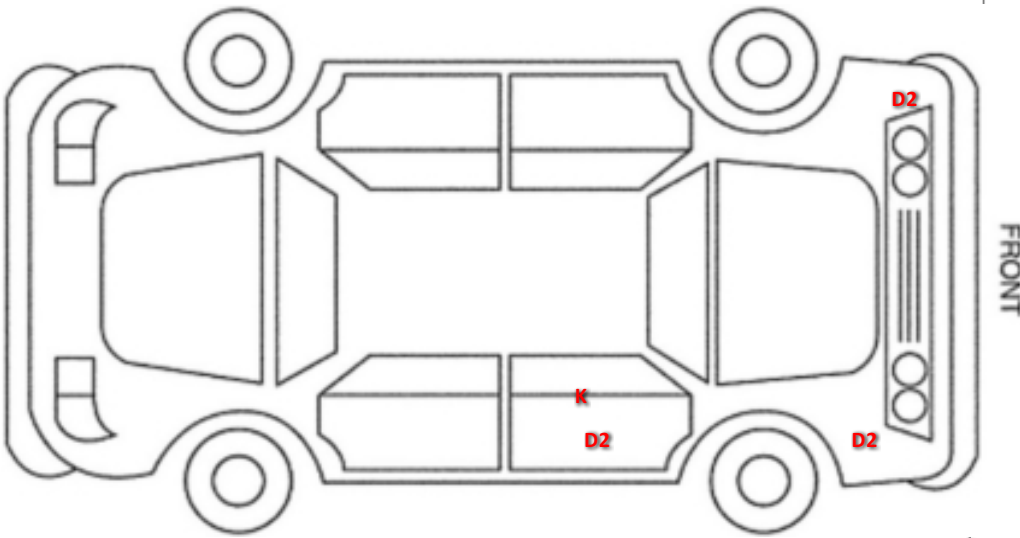

Splat Key

D2
Dent/damage 30-100mm
K
Crack/Torn